


El edificio es una respuesta a un vacío, un vacío que no se llena, se completa. Es muralla habitada, es la recuperación de un paso desde los fosos hasta la ciudadela a través de sucesivas estancias como a ocurre en otros baluartes, es ahora final del paso de ronda como nuevo mirador sobre la ciudad, y la adecuación de un vacío artificial que pide no serlo. Es una puerta y un filtro que recoge al peatón desde la ciudad a través del arte, hacia el gran espacio abierto de la ciudadela proyectado ahora como un parque vital con exposiciones al aire libre, alrededor de una escuela de bellas artes. El volumen se excava, busca la luz y los recorridos sin olvidar la trama urbana que dio lugar al vacío, presente, protagonista. El vacío esta presente pero ahora cobra nueva importancia, apoyado en el muro, se proyecta como volumen y se asoma a la ciudadela través del cuerpo de cristal, ligero, sutil, luminoso. El muro reconstruido que cierra el vacío artificial, pasa a ser fachada del edificio a la ciudad cobrando de esta forma un nuevo significado más allá de la mera tapia de jardín, este muro es un prisma que envuelve el edificio, en el que se excavan recorridos y entradas de luz, los huecos, pocos y marcados, buscan reafirmar las dimensiones y escala del elemento pétreo.

The building responds to a void, a void which is not filled, but rather is completed. It is an inhabited wall, the recovery of crossing from the moat to the citadel through successive rooms, as occurs in other fortresses. It is now the end of the walkway as the new point overlooking the city, and the adaptation of an artificial void which is calling out to be filled. It is at the same time a door and a filter which, through art, guides the pedestrian from the city towards the enormous open space of the citadel, now conceived of as a living park with open air exhibitions, all situated around a school of fine arts. Volume is excavated in a search for light and paths, without losing sight of the urban stretch which caused this void, present and playing a leading role. The void is present, but it has now taken on new importance. With the wall as its support, it projects itself as volume; it appears at the citadel through a delicate and subtle body of glass, full of light. The reconstructed wall which closes off this artificial void becomes the facade of the wall of the city, imbuing this form with new meaning which goes beyond that of a mere garden wall. It has become a prism which surrounds the building, in which paths and shafts of light can be devised, and the empty spaces, few and well-defined, look to attest to the dimensions and scales of the stone element.

centro de arte contemporáneo en la ciudadela de Pamplona  
centre for contemporary art in the citadel of Pamplona

isabel arellano galíndez

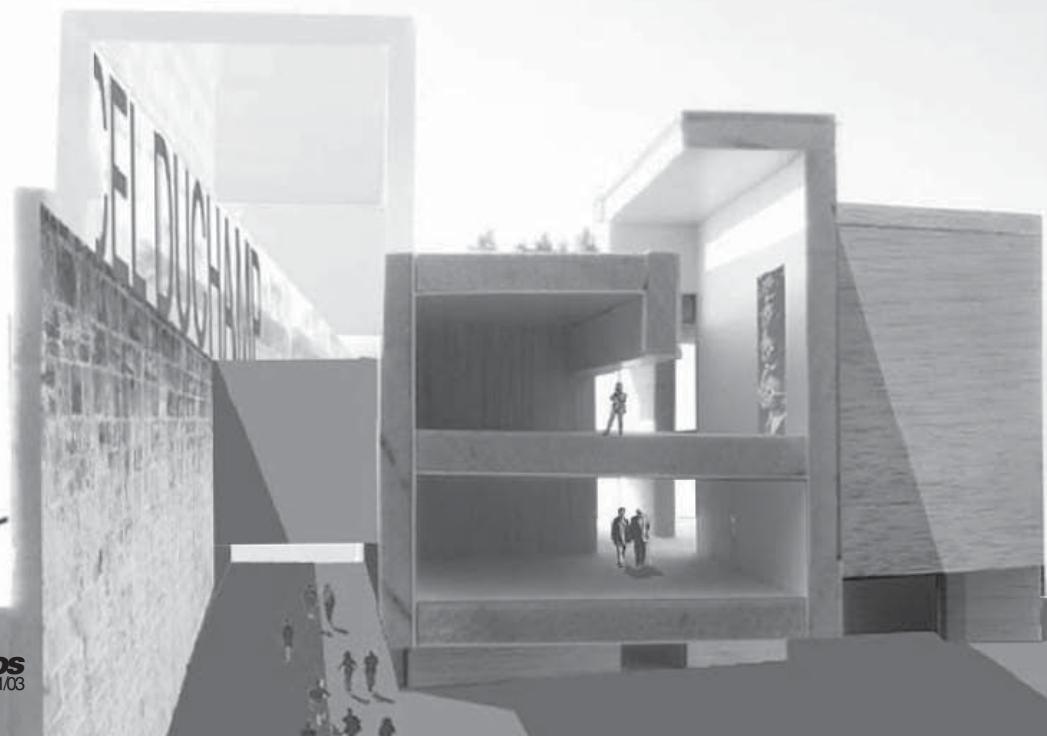



A detailed black and white architectural map of a city area. The map shows various streets, buildings, and landmarks, including a prominent stadium-like structure with a distinctive roofline. Overlaid on the map are two sets of large, bold, black text. At the top, the words 'ciudadela' and 'PARQUE DE ARTE' are stacked vertically. At the bottom, the words 'ACCESO ITURRAMA' are written horizontally. The text is in a sans-serif font and stands out against the intricate lines of the map.

# ACCESO URBA


# ACCESO SUR

Nueva Estación  
Autobuses

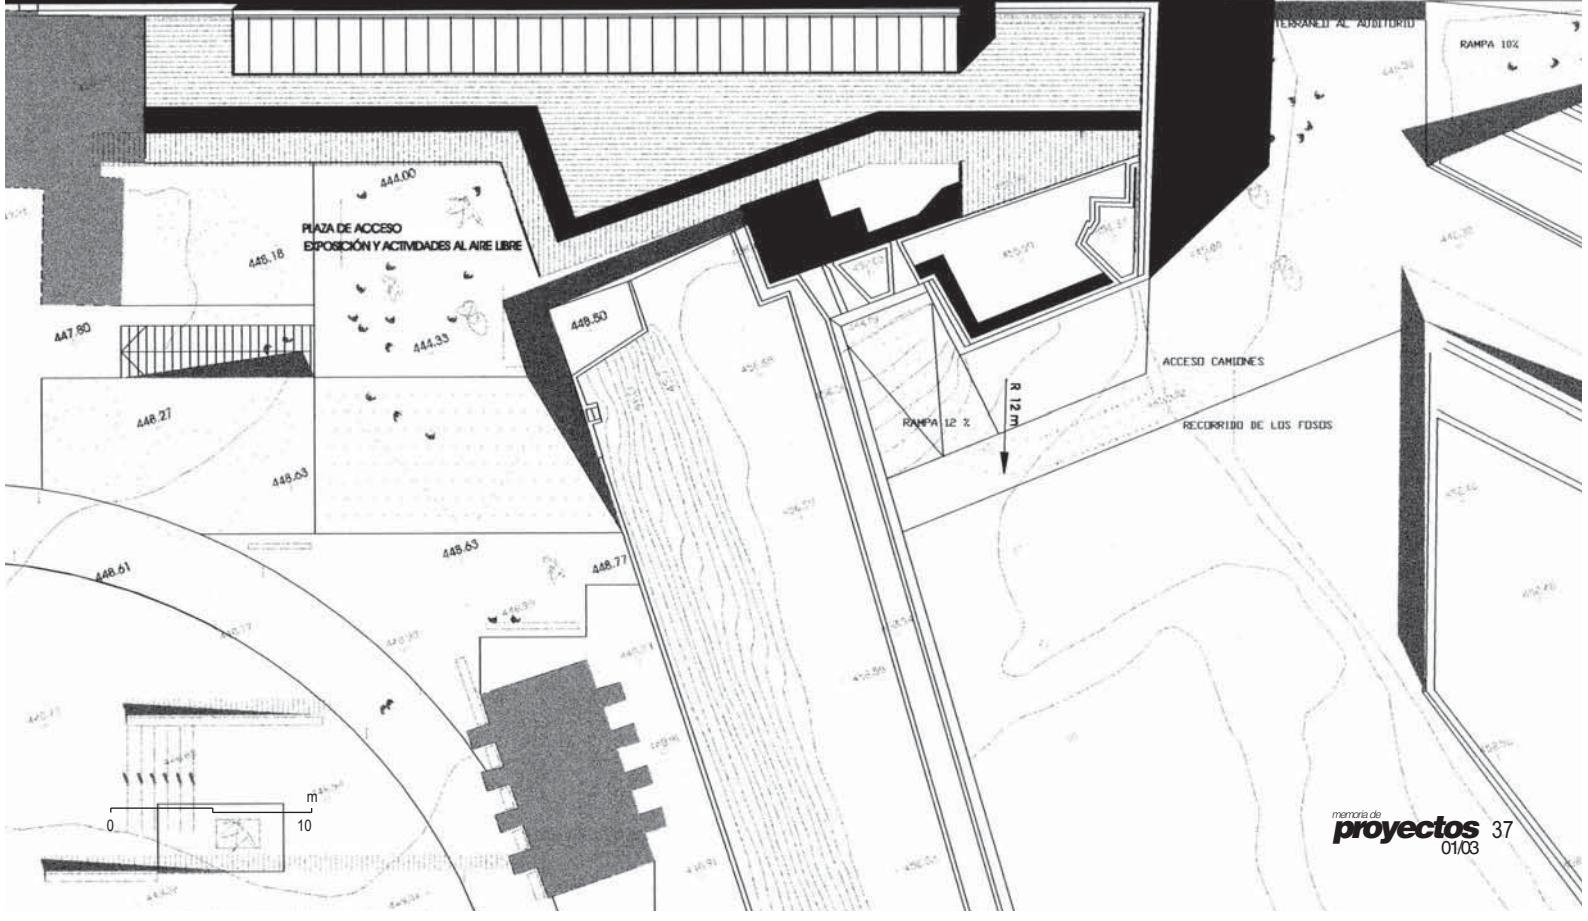


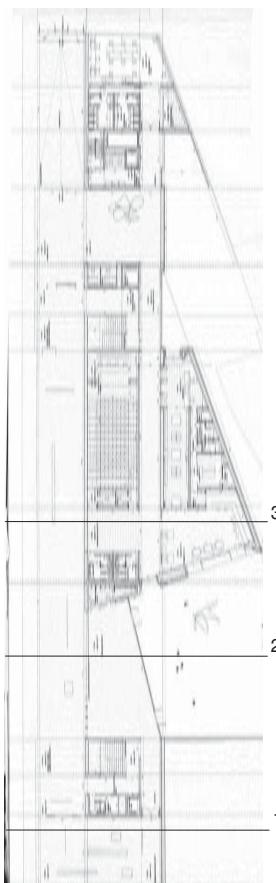


planta cota +444.0 m  
floor level +444.0 m

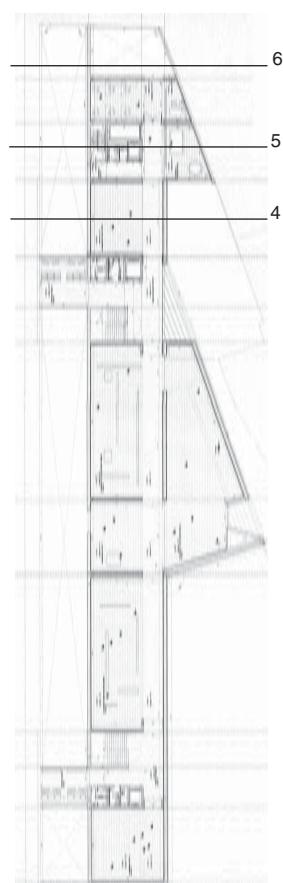

planta cota +448.0 m  
floor level +448.0 m

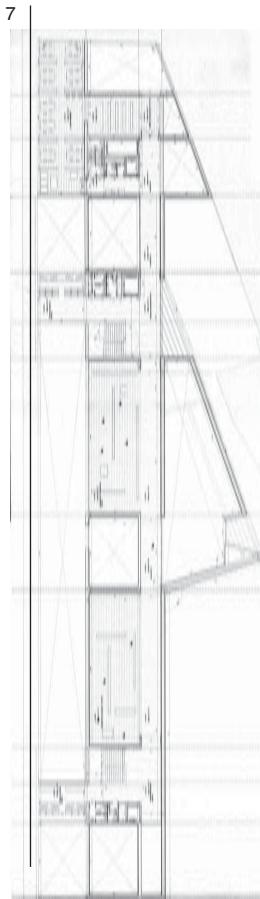


planta cota +452.0 m  
floor level +452.0 m

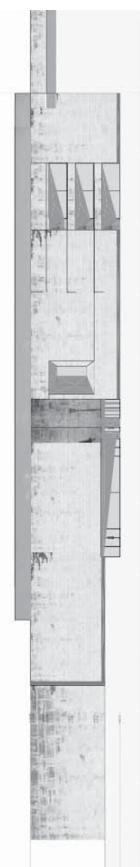


alzado longitudinal  
longitudinal elevation



sección 1  
section 1

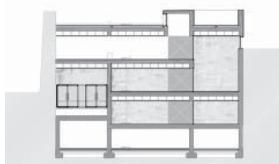


sección 6  
section 6

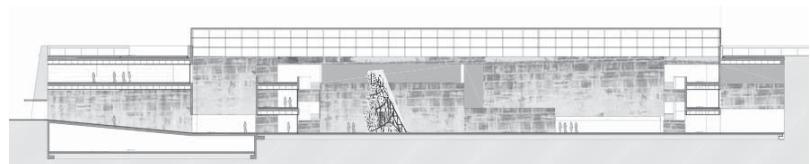

sección longitudinal 7  
longitudinal section 7




sección 2  
section 2

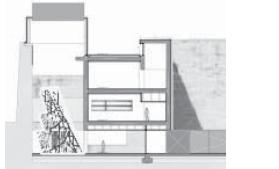




sección 3  
section 3



sección 5  
section 5

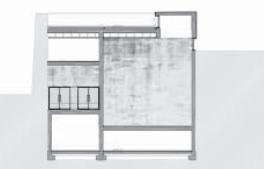

sección 6  
section 6

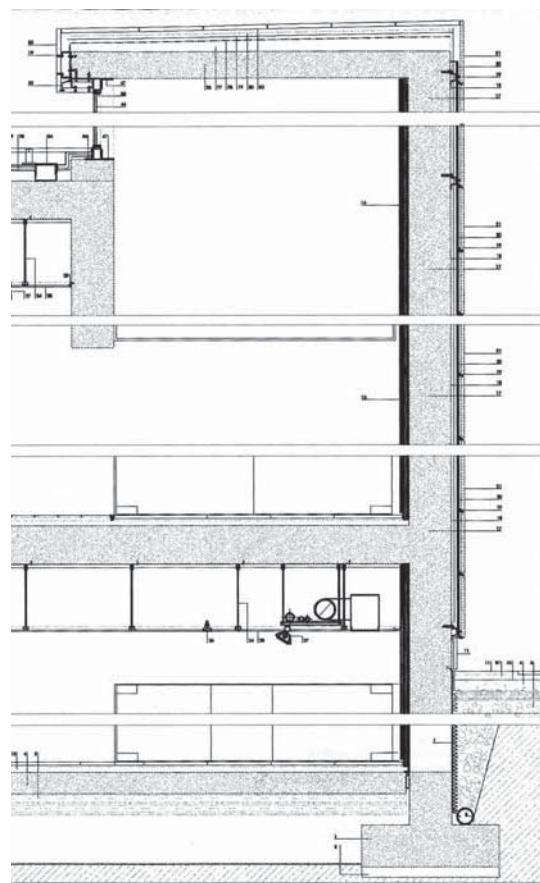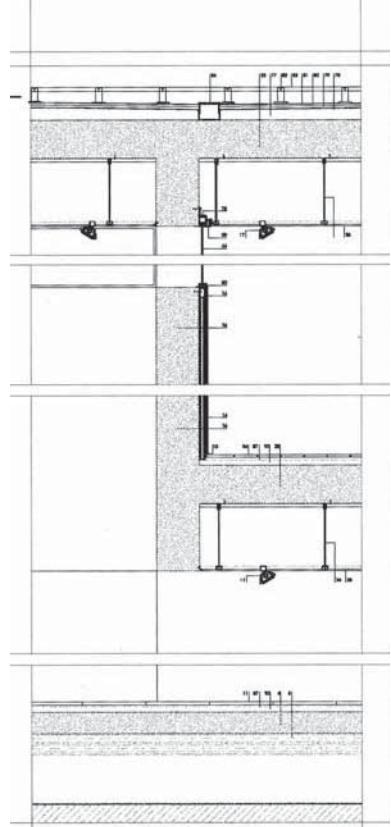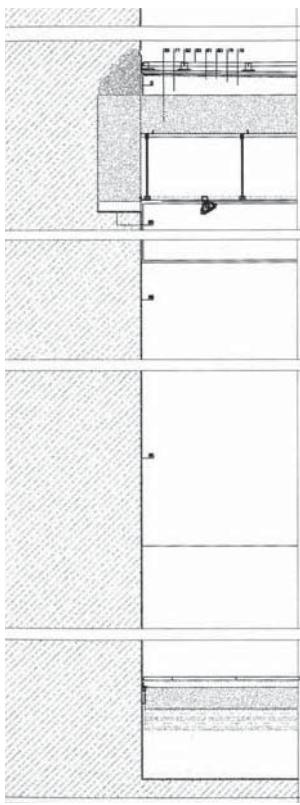

1 Zapata hormigón armado  
 2 Hormigón de limpieza  
 3 Encache de piedra  
 4 Alera de hormigón armado  
 5 Junta de poliestireno  
 6 Tubo dren  
 7 Huevera  
 8 Lámina impermeabilizante  
 9 Relleno de grava trasdós de muro  
 10 Mortero de regularización  
 11 Solada de piedra cuarcita celeste  
 12 Perfil acero L40.400.1  
 13 Rodapie de chapa galvanizada  
 14 Trasdoso pladur  
 15 Chapado. D piedra cuarcita celeste  
 16 Muro de carga de hormigón armado  
 17 Aislamiento de poliuretano proyectado  
 18 Perfil de acero galvanizado. sistema de anclaje  
 19 Anclaje de acero inoxidable  
 20 Fijación al forjado y a los muros con taco químico  
 21 Piedra caliza  
 22 Chapa a.g. conformada  
 23 Forjado losa nervada  
 24 Subestructura de cuelgue de falso techo anclada a nervios del forjado  
 25 Falso techo pladur M e 1.5  
 26 Iluminación empotrada  
 27 Carril electrificado para proyectores  
 28 Bandeja de cuelgue de instalaciones  
 29 Remate falso techo capa a.g.  
 30 Hormigón visto encorvado con tablas  
 31 Rastrel pino 4x4 cm  
 32 Empalmeda de madera de haya vaporizada junta vista a 15 mm  
 33 Contra chapeado formado de fornica negra 3 mm en Junta de paneles de haya  
 34 Bloque de hormigón  
 35 Rastrel de pino. Sujeción de empanelado de madera  
 36 Alicatado cerámico gres  
 37 Falso techo acústico  
 38 Marco de madera de haya  
 39 Puerta semimaciza acabada en haya  
 40 Manilla de acero inoxidable salinado  
 41 Puerta de madera de pino pintada de blanco  
 42 Perfil L 15.15.1 de acero galvanizado

43 Premarco de madera de pino  
 44 Vidrio climalit con luna stadip 6+8+(3+3) con butiral  
 45 Guía de giro con escobilla  
 46 Pieza de giro superior  
 47 L 90.60.10.  
 48 Premarco a.g.  
 49 Perfil BR45483 a. Inox. Mate  
 50 Junquillo a.g. 70.60.2.  
 51 Vidrio climalit 6+12+6  
 52 U neopreno 30.10.  
 53 Eje excentrico rodamiento de puerta  
 54 Cordon de silicona estructural unión de vidrios en junta vertical  
 55 Premarco a.g. 70.120.2.  
 56 L 80.80.10.  
 57 Montante perfil hueco de a.g. 90.50.4.  
 58 Premarco a.g. 50.20.2.  
 59 Premarco a.g.a.g.p. 170.85.2.  
 60 Perfil serie B5479  
 61 Sellado con silicona incolora neutra  
 62 Barrera fónica pladur WA 13mm  
 63 O16 acero inoxidable mate  
 64 O8 rosca metálica  
 65 O 6 acero inoxidable mate  
 66 Marco de chapa a.g. 2mm  
 67 Marco de chapa a.g. 2mm  
 68 Luna seguridad tipo stadip B/17 8+1+8  
 69 Barrera fónica tipo pladur  
 70 Montante perfil hueco de a.g. 2mm  
 71 Junquillo de chapa de acero 2mm. Atornillado y ensarado a perfil de carpintería  
 72 Pieza de remate de falso techo a.g  
 73 Sistema Roll Glass KLEIN inferior  
 74 Pieza de corredura superior sistema Roll Glass de KLEIN  
 75 Premarco perfil hueco  
 76 Premarco  
 77 Hormigón celular para formación de pendientes  
 78 Lamina impermeabilizante de betún modificado  
 79 Aislamiento de panel de poliestireno extruido 4c  
 80 Geotextil de 140 gr/m<sup>2</sup>  
 81 Capa de protección de mortero de cemento 2 cm  
 82 Soportes regulables en altura tipo PL 50/700/100  
 83 Solado lasas piedra caliza. Sobre soporte regulable  
 84 Solado lasas piedra caliza  
 85 Tarima JUNKERS e 20 mm  
 87 Capa de arena  
 88 Plancha neopreno para apoyo

1 Reinforced concrete base  
 2 Blinding concrete  
 3 Stone paving  
 4 Reinforced concrete bed  
 5 Polystyrene joints  
 6 Drain tube  
 7 Eggcup  
 8 Waterproofing sheet  
 9 Gravel-filled wall batter  
 10 Normalization mortar  
 11 Light blue quartzite stone floor  
 12 L 40.400.1 steel section  
 13 Galvanized steel plate baseboards  
 14 Plasterboard battering  
 15 Light blue quartzite stone cladding  
 16 Reinforced concrete supporting wall  
 17 Pneumatically applied polyurethane insulation  
 18 Galvanized steel section anchorage system  
 19 Stainless steel anchorage  
 20 Anchorage to slab and walls with chemical plugs  
 21 Limestone  
 22 A.g. boss plate for facade finishing  
 23 Ribbed top slab  
 24 Suspended ceiling sub-frame anchored to slab ribs  
 25 Suspended M 1.5 plasterboard ceiling  
 26 Recessed lighting  
 27 Electrified rail for projectors  
 28 Hanging tray for installations  
 29 Hanging ceiling finished with a.g. layer  
 30 Board faced concrete formwork  
 31 4x4 cm pine fillet  
 32 15 mm exposed joint steam-treated beech wood paneling  
 33 3 mm black Fornica veneer in beech panel joints  
 34 Concrete block  
 35 Pine fillet. Fixed wood paneling  
 36 Stoneware tiling  
 37 Suspended acoustic ceiling  
 38 Beech wood frame  
 39 Semi solid wood door with beech finish  
 40 Saltined stainless steel handle  
 41 White painted pine door  
 42 L 15.15.1 galvanized steel section  
 43 Pine sub-frame  
 44 Climalit glass with 6+8+(3+3) Stadip glass with butiral  
 45 Turn rail with brush  
 46 Upper turn piece  
 47 L 90.60.10  
 48 A.g. sub-frame  
 49 BR45483 matt stainless section  
 50 A.g. 70.60.2 tongue  
 51 6+12+6 Climalit glass  
 52 Neoprene U 30.10  
 53 Eccentric stud door bearing  
 54 Structural silicon chard joint for vertical joint of glass panes  
 55 A.g. 70.120.2 sub-frame  
 56 L 80.80.10  
 57 A.g. 90.50.4 hollow section vertical girder  
 58 A.g. 50.20.2 sub-frame  
 59 A.g.a.g.p. 170.85.2 sub-frame  
 60 B5479 series section  
 61 Neutral, clear silicone sealing  
 62 13 mm WA plasterboard sound barrier  
 63 O16 matt stainless steel  
 64 O8 metallic thread  
 65 O 6 matt stainless steel  
 66 A.g. 2mm sheet frame  
 67 AA.g. 2mm sheet frame  
 68 B/17 8+1+8 Stadip safety glass  
 69 Plasterboard sound barrier  
 70 A.g. 2mm hollow section vertical girder  
 71 2 mm steel sheet tongue. Screwed in flush to metalwork section  
 72 A.g. finishing piece for suspended ceiling  
 73 Lower KLEIN Roll Glass system  
 74 KLEIN Roll Glass system upper slide piece  
 75 Hollow section sub-frame  
 76 Sub-frame  
 77 Porous concrete to form slope  
 78 Modified asphalt waterproofing sheet  
 79 4 cm polystyrene extrusion panel insulation  
 80 140 gr/m<sup>2</sup> geotextile  
 81 2 cm cement mortar protective layer  
 82 PL 50/700/100 adjustable height supports  
 83 Solid stone slab flooring over adjustable base  
 84 Solid stone slab flooring  
 86 JUNKERS 20mm floorboards  
 87 Sand layer  
 88 Neoprene support sheet